Winmate VESA Bracket Mounting Kit
(For S-Series HMI:
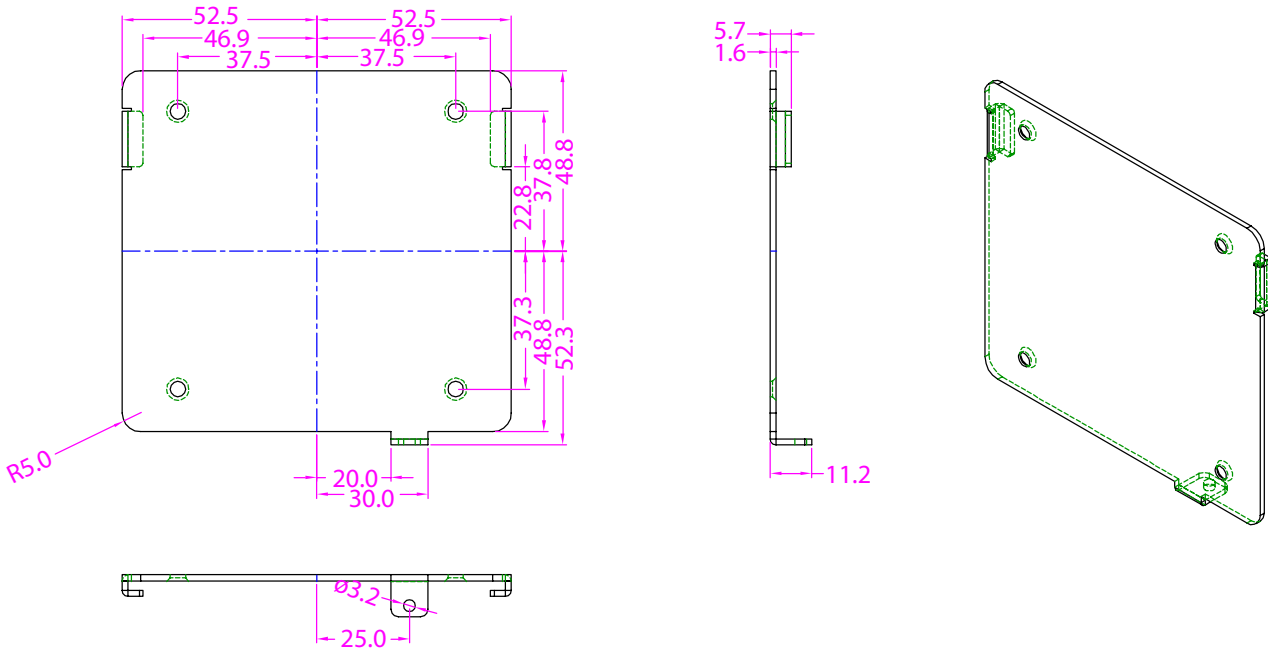- W10IB3S-PCH2AC-PoE
- W10IB3S-PCH2-PoE)

Mechanical Drawing:

How to use Winmate VESA Bracket Mounting Kit ?

1
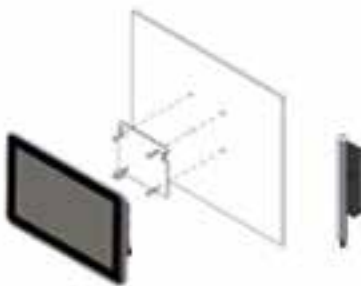
Screw VESA bracket to the fixture (ex. wall) with four M4 x 8 mm flathead screws.

2

Place the device on the VESA bracket.

NOTE:
Please notice that both hooks on bracket should lock the notches on the back cover of the device.

3

Secure the device from the bottom with one M3 x 5 mm flathead screw.