


SI 100 & SI 200 Quick Keypad Guide Configure Probe



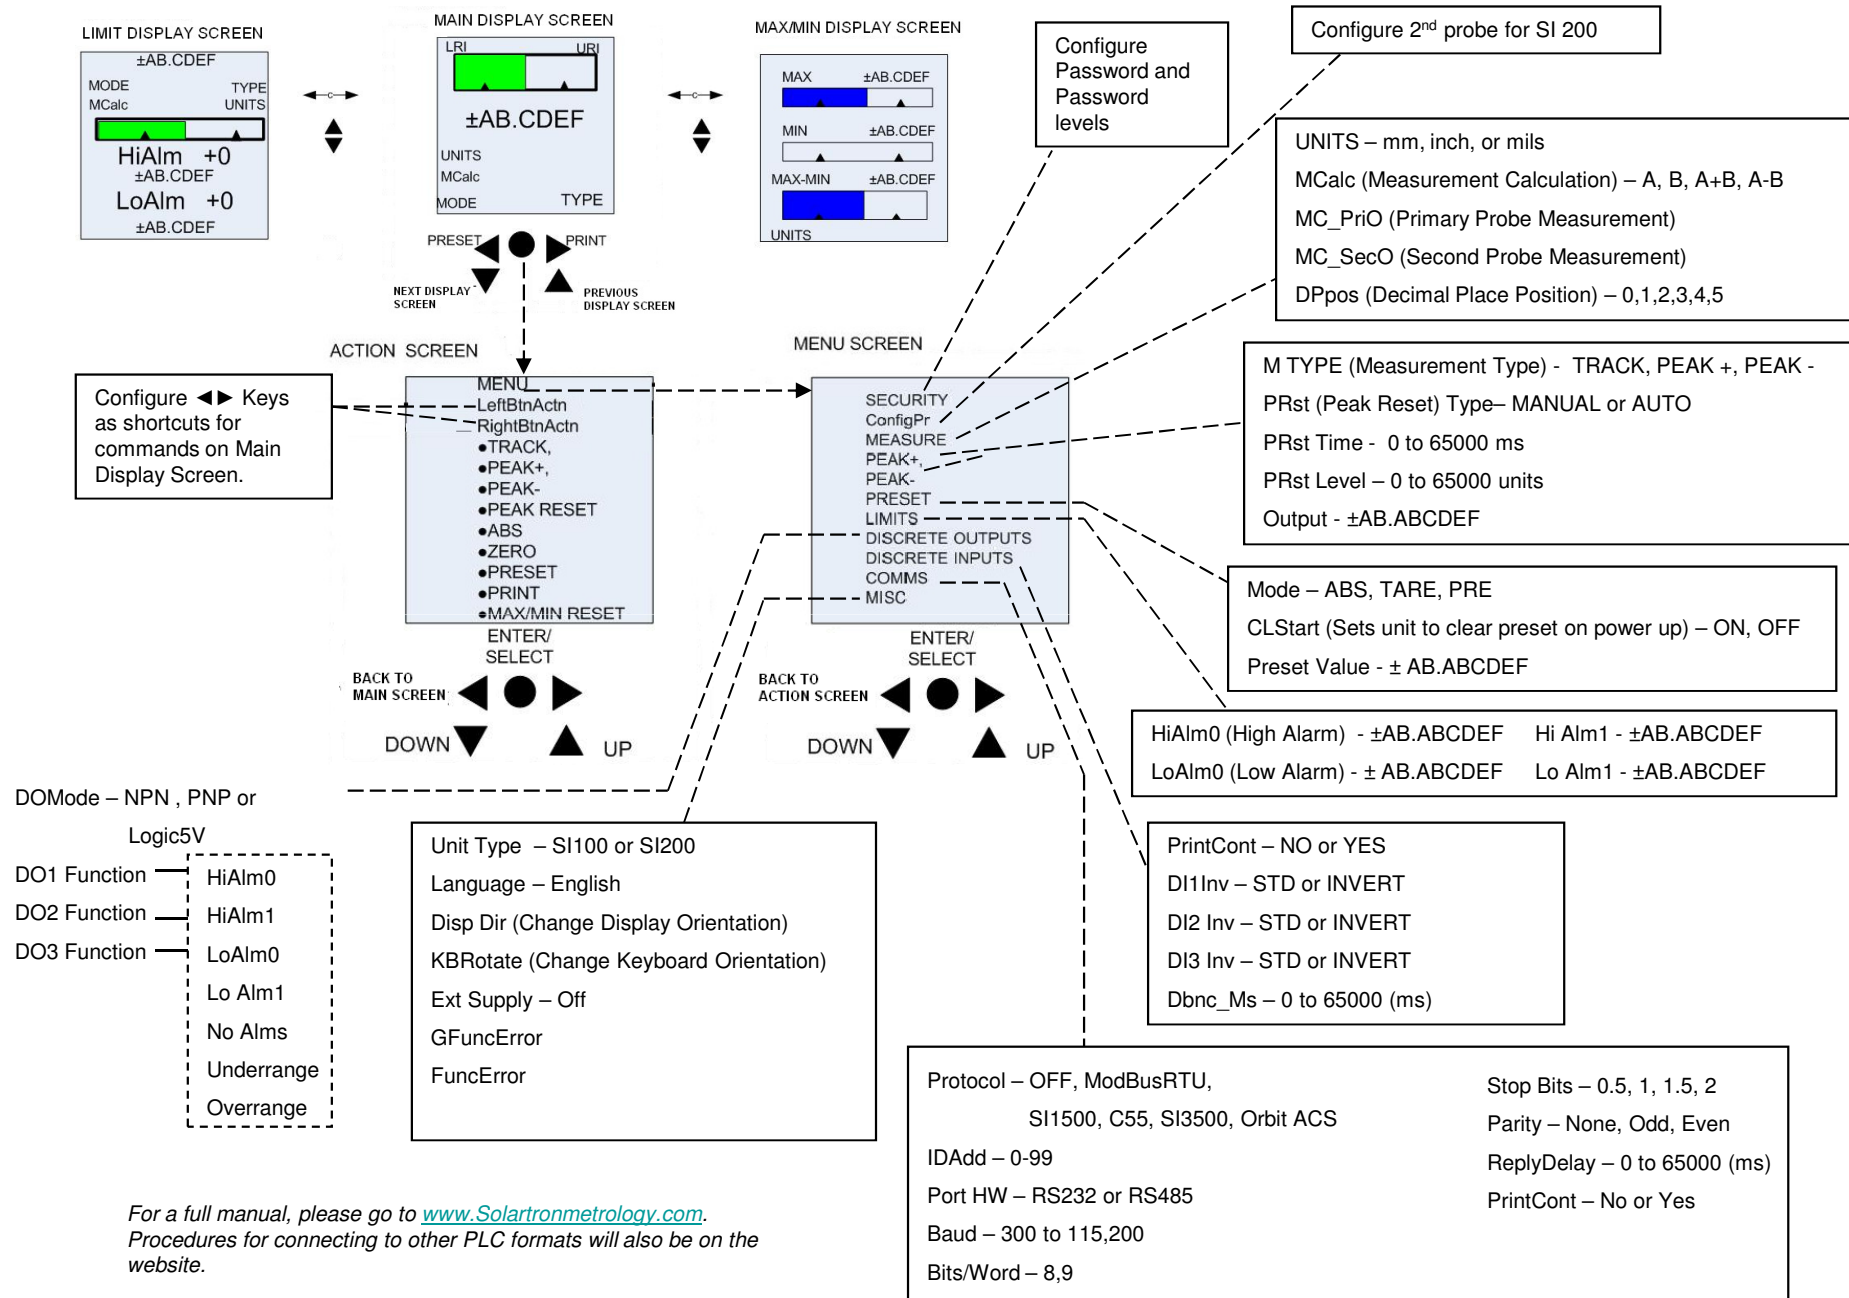


Power Connections

- 12 Input 4
- 11 Input 3
- 10 Input 2
- 9 Input 1
- 8 External Supply for Outputs
- 7 Output 3
- 6 Output 2
- 5 Output 1
- 4 Serial Connection: RS232Rx or RS485 B
- 3 Serial Connection: RS232Tx or RS485 A
- 2 0V Power
- 1 18-32V DC Power

Operating Currents (mA) (nominal)		
	SI100 or SI200	SI200 + 1 DP
18V	60	80
24V	52	68
32V	50	62

Mini-USB Port for
configuration via
a PC and
firmware updates

MAINS TO +24V DC POWER
BLOCK (ACCESSORY)

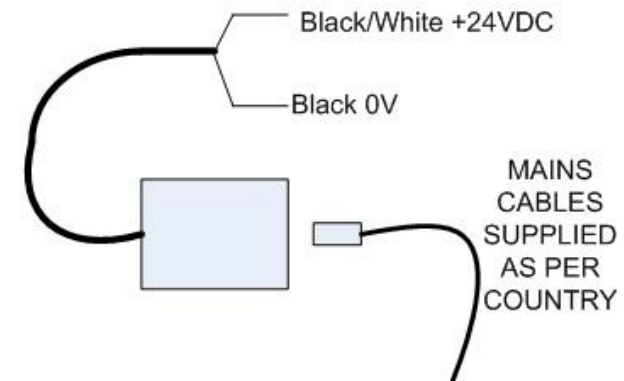

A mating connector is supplied with each unit
(This can be removed for wiring)
Additional connectors can be purchased from Solartron Metrology
OR Phoenix Contact Part Number MC1,5/12-ST-3,5
OR Camden Part Number CTB92HD/12